

LABORATORY TEST REPORT

Sample Details:	URBANE II RHS WB	Report No.:	RD24-227-2
Product Code:	878700W	Sample No.:	10013
Material Type:	N/A	Test Date:	19/11/2024
Manufacturing Site:	N/A	Inspector:	ZL
REFERENCED STANDARDS			
Product Specification:	N/A	Installation Instruction:	N/A
Inspection Drawing:	N/A	Caroma Test Procedure:	N/A
Bill of Materials (BOM):	N/A	Australian Standard:	AS1172.4

PURPOSE OF EVALUATION


Basin load test

SAMPLE AS-RECEIVED

Basin

URBANE II RHS WB		URBANE II RHS WB NTH NOF 878700W Qty. 1 Made in ITALY Inspected by: SCA 13/11/2020 9 311440 508393 For other details refer: Current Technical Manual
------------------	--	--

Fixing kit

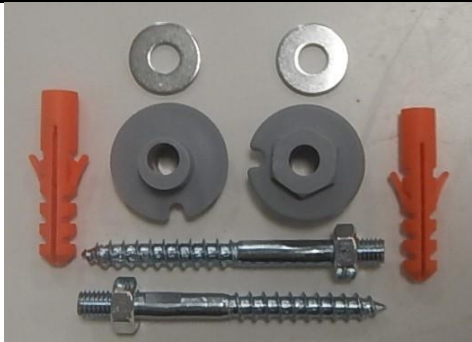D200 Wall Basin Fixing Kit	
Sample No.:	10013
Date Received:	18/11/2024

Comments/Observations:

- Samples submitted by Johann
- Test method refers to AS1172.4:2019 – Appendix B Wall basin load safety test

TEST RESULTS

AS1172.4:2019 - Appendix B Wall basin load safety test

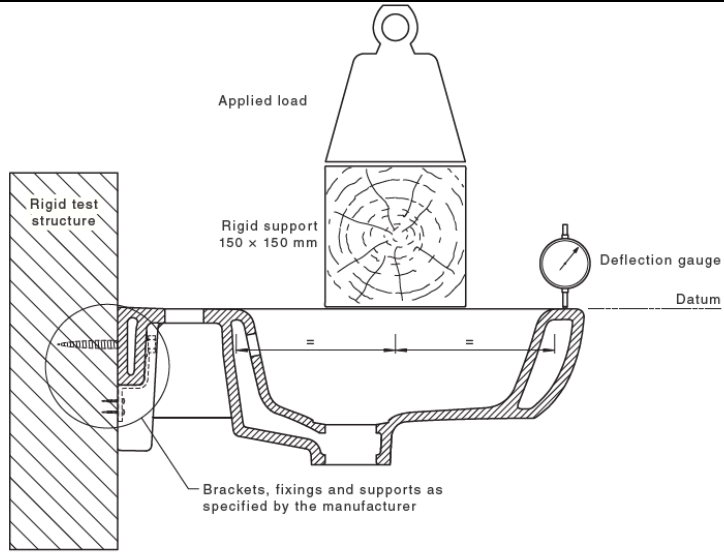


Figure B.1 — Typical arrangement for load safety test for washbasin

Maintain 150kg load for 60min

Basins	Fixing kit	Underload deflection	Permanent deformation	Observations and comments
Urbane II RHS WB (878700W)	D200 Wall Basin Fixing Kit	11.0mm	1.3mm	No cracking, splitting, crazing or leakage of the basin observed after load test

Photos:

URBANE II RHS WB

